

TRUCK CARGO MEDIUM MC2 - (UNIMOG)  
TRAY SEATING GRAB HANDLE

MODIFICATION INSTRUCTION

Issue of this instruction is authorised by the CONMEA

Introduction

1. This instruction details the reworking of the tray seating assemblies to provide a grab handle to assist troop mounting.

General

2. Estimated Manhours to Perform. 2.0 (initial planning only).
3. Priority. Group 2.
4. Modification to be Applied to. All subject vehicles.
5. Items Affected. Rear tray seat assemblies.
6. Action Required. By RAEME units authorised to carry out unit, field and base repairs, in accordance with WKSP A 850.

Detail

7. To carry out the modification proceed as follows:
  - a. Cut a section from the right and left rear seat panels as shown in Fig 1.
  - b. Paint in accordance with WKSP B 700. Ensure the end grain of the plywood is fully sealed. Finish using ENAMEL, LUSTRLESS, OLIVE DRAB as shown in Fig 2.
8. Modification Record Plate. On completion of the modification deface the numeral 7 from the modification record plate situated on the right hand side of the drivers seat base.

UNCONTROLLED WHEN PRINTED

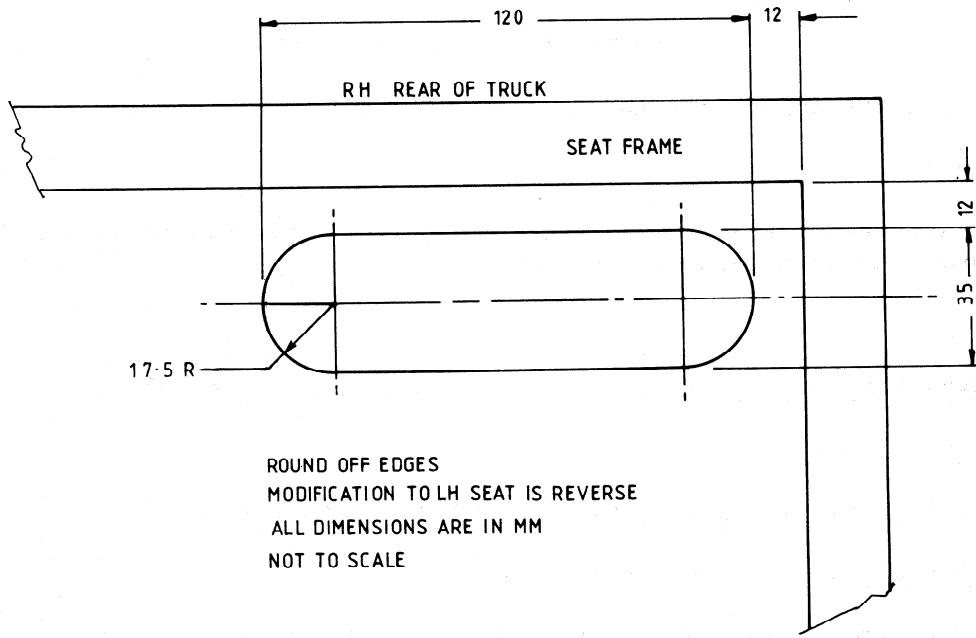


FIG 1 - GRAB HANDLE DETAILS

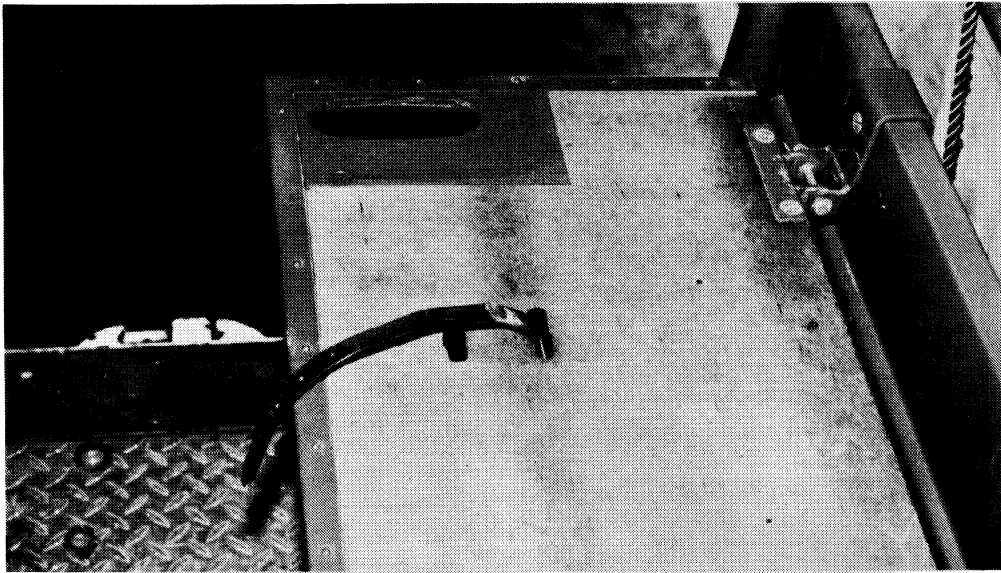


FIG 2 - COMPLETED MODIFICATION

E N D

Class 25.4 - Code 4 (MEA 469/84)